



BRCOAMPBRKTD

Drivers Side

BRCOAMPBRKTP


Passenger Side

Under Seat Amplifier Mounting Bracket for 2021-2022 Ford Bronco

Amplifier Mounting

Amplifier mounting holes are pre-drilled and threaded for select amplifiers listed below. Four M4x10 (3mm Allen) screws are supplied for mounting the amplifier. NOTE: When mounting different model amplifiers, it is recommended to temporarily install the bracket in the vehicle and determine a mounting position for the amplifier that will not interfere with the seat. For larger amplifiers, the wiring connections may need to be made before attaching the amplifier to the mounting bracket.

- A** - Phoenix Gold MX Series, All
- B** - Stinger SPX700X4
- C** - Stinger SPX350X2
- D** - AudioControl ACX-300.4
- E** - AudioControl ACX-600.1

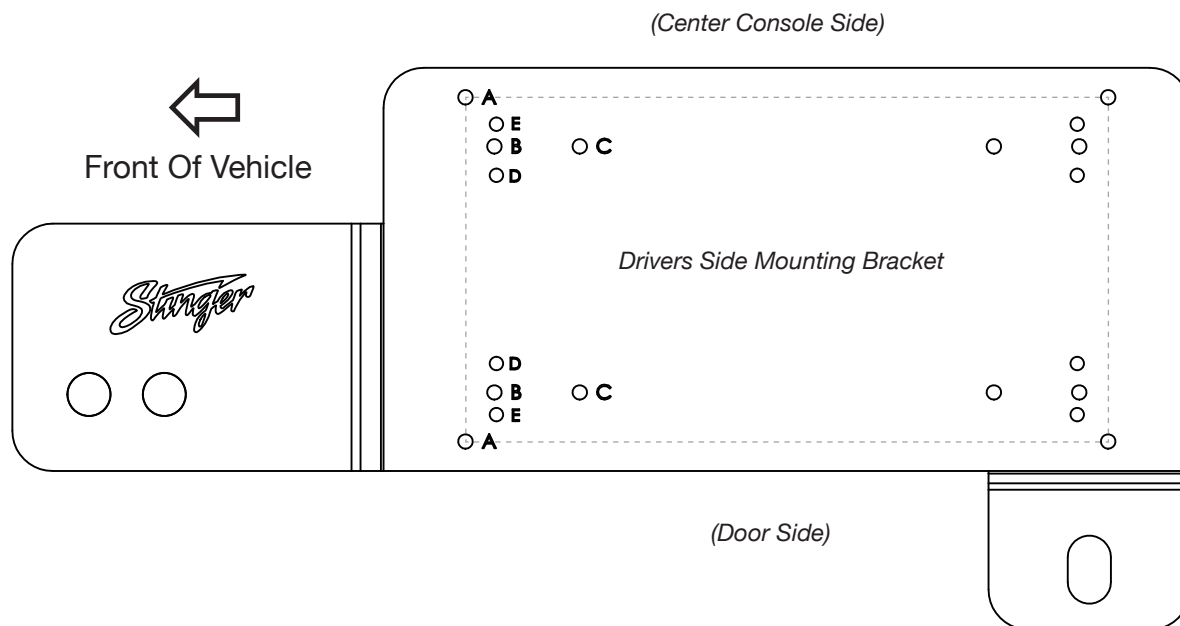

Installing the Mounting Bracket

For either side, the amplifier mounting bracket is placed under the front seat and secured using one front and one rear seat bolt (on the outboard side closest to the door). Once all amplifier connections and settings are made, attached the amplifier to the mounting bracket, align the the mounting bracket with the seat bolt holes and reinstall the seat and seat bolts. NOTE: If the seat is going to be unplugged and removed, always follow the vehicle manufacturers instructions for removing and re-installing the seat.

Replacement Mounting Screws:

Alloy Steel Socket Head Screw, Black-Oxide, M4-0.7 Thread, 10mm Long

McMaster-Carr # 91290A144

Limited Warranty

Stinger warrants this product to be free of defects in materials and workmanship for a period of one (1) years from the original date of purchase. This warranty is not transferable and applies only to the original purchaser from an authorized Stinger dealer in the United States of America only. Should service be necessary under this warranty for any reason due to manufacturing defect or malfunction, Stinger will (at its discretion), repair or replace the defective product with new or remanufactured product at no charge. Damage caused by the following is not covered under warranty: accident, misuse, abuse, product modification or neglect, failure to follow installation instructions, unauthorized repair attempts, misrepresentations by the seller. This warranty does not cover incidental or consequential damages and does not cover the cost of removing or reinstalling the unit(s). Cosmetic damage due to accident or normal wear and tear is not covered under warranty.

INTERNATIONAL WARRANTIES:

Products purchased outside the United States of America are covered only by that country's Authorized Stinger reseller and not by Stinger. Consumers needing service or warranty information for these products must contact that country's reseller for information.



Stinger is a Power Brand of AAMP Global
15500 Lightwave, Clearwater, Florida 33760
Phone: 888-228-5560

Technical Support

Phone: 727-592-5991

Email: support@stingerelectronics.com

Chat: [stingerelectronics.com](https://www.stingerelectronics.com)

QSG-BRCOUAMPBRKT REV 080522

© 2022 AAMP Global. All rights reserved.